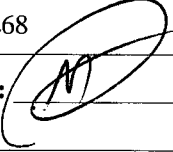


Work Order ID 143691***143691***

Page 1

Monday, March 21, 2016 1:42:44 PM

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: URF15-560 Stop ***NS2***
Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
Start Date: 3/21/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 3/22/2016 Req'd Qty: 1.00 ***1*** Customer: CAGUS02
Reference: RMA RA112268

Approvals: Process Plan:  Date: 6-3-21 Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D3887-041	D								
IIN-D119-646	C								

100

0.00

100

Skidtubes

Memo

PD 16-3-21

0.00

Skidtubes

ADD HOLES AS PER DSI-9734

 16-3-21

105

0.00

105

HandFinish

Memo

0.00

Hand Finishing

TOUCH UP AS REQUIRED

 16-3-21
(Alodine)

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 143691

Monday, March 21, 2016 1:42:44 PM

143691


Page 2

Item ID: D119-646-041 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: URF15-560 Stop ***NS2***
 Item Name: Replacement Skidtube with Wearpads, Fits LH or RH
 Start Date: 3/21/2016 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 3/22/2016 Req'd Qty: 1.00 ***1*** Customer: CAGUS02
 Reference: RMA RA112268

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

115	QC6- Inspect dimensions to drawing	0.00							
115	QC								DAS 9 9-89
Quality Control	Memo								

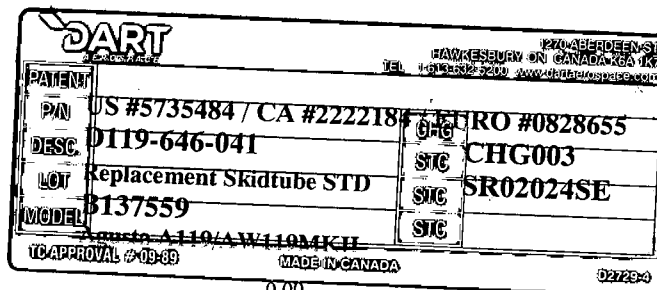

125	Packaging								
125	Packaging								DAS 28 9-89
Packaging	Memo								DAS 27 9-89
	REPACKAGE USING NEW BACTH NUMBER								MAR 21 2015

130	QC21- Final Inspection - Work Order Release	0.00							
130	QC								
Quality Control	Memo								

16/3/21

16-321

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By 	
								Lead hand / Supervisor Approval Verification 	
								QC / QA Coordinator Approval 	

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

Picklist Print

Monday, March 21, 2016 1:42:44 PM

Page 1

Work Order ID: 143691

143691

Parent Item: D119-646-041

D119-646-041

Parent Item Name: Replacement Skidtube with Wearpads, Fits LH or RH

Start Date: 3/21/2016

Required Date: 3/22/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP RevA: New issue DD verified by:EC
10.02.22 per PAR 09-043 EC verified by:DD IPP rev B
(DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 12.11.05
chg003 ECN13-534 DD verf:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D119-646-041

Manufactured No

Each 0.0000

D119-646-041

Replacement Skidtube with Wearpads, Fits LH or RH

**

①
137559
16-3-21

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process								
Misidentified ☐	☐ Past Due	OTHER :							

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IIN-D119-646 REV. C
AND INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D119-646 REV. 2
REF FAA STC: SR02024SE
REF EASA STC: 10040294

1.0 PURPOSE:

The purpose of this Dart Service Instructions is to add D119-646-313/-314 Skidtube Protector Kit to make the D119-646-011/-012/-111/-112/-211/-212 Skidtube Kits compatible with the 109-0812-68-105 Hoist Structural Provision Kit and the 109-0816-18-301 Rappelling Kit. The D119-646-313 Skidtube Protector, LH replaces the 109-B710-05-201 kit and the D119-646-314 Skidtube Protector, RH replaces the 109-B710-05-202 kit.

2.0 D119-646-313/-314 INSTALLATION:

These instructions are for modifying the D119-646-011/-012/-111/-112 Skidtube Installations.

- 2.1 Remove D3492-045 Plug Assemblies from two locations on each side of the skidtube as shown in Figure 3.
- 2.2 Position D5376-1 drilling jig tool with the arrow pointing fwd as shown in Figure 3. Use 2x AN3-45A bolts to hold the jig in place. Transfer drill 4x $\varnothing 0.129$ " (#30 drill) holes from D5376-1 drilling jig to skidtube ridge as shown in Figure 3. **Caution:** Drill perpendicular to the skidtube ridge.
- 2.3 Remove drilling jig. Using a 5/16" drill, open up the pilot holes and drill through the skidtube ridge and center web inside of the skidtube. **Caution:** Drill perpendicular to the skidtube ridge.
- 2.4 Countersunk 4x 5/16" holes to $\varnothing 0.348$ " (8.84mm) x 100° as shown in Figure 3 and deburr.
- 2.5 Repeat steps 2.2 to 2.4 for the opposite side of the skidtube.
- 2.6 Vacuum the debris from inside of the skidtube. Touch up affected area using (Alodine 1200 or 1201) per MIL-DTL-5541.
- 2.7 Install 8x D5374-3 Bushings in the new holes. Seal bushings with Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class 'B2' sealant as shown in Section C-C.
- 2.8 Remove all D3492-045 Plug Assemblies from skidtube fwd of the ground handling wheel lugs.
- 2.9 If the D119-646-314 Skidtube Protector Kit is required for hoisting operations on the RH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 2.10 If the D119-646-313 Skidtube Protector Kit is required for hoisting operations on the LH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 2.11 If the D119-646-314 Skidtube Protector Kit is required for rappelling operations on the RH side of the aircraft install D5371-2 Hook using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 2.12 If the D119-646-313 Skidtube Protector Kit is required for rappelling operations on the LH side of the aircraft install D5371-1 Hook using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 2.13 Install D5369-2 Cable Guard on the RH side of the aircraft using 6x AN3-47A bolts, 6x D5374-1 Bushings, 6x D4506-3 Washers, 12x NAS11490D332J washers, 6x MS21042L3 nuts as shown in Figure 1 Section A-A. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 2.14 Install D5369-1 Cable Guard on the LH side of the aircraft using 6x AN3-47A bolts, 6x D5374-1 Bushings, 6x D4506-3 Washers, 12x NAS11490D332J washers, 6x MS21042L3 nuts as shown in Figure 1 Section A-A. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 2.15 Update aircraft log book to indicate installation of the D119-646-313/-314 kit and adjust weight and balance record for the aircraft with weight and balance data provided in Section 5.0 of this document.

NOTE: Additional NAS11490D332J washers may be installed under the nuts to ensure 1.5-4 threads in safety on the bolts. Although not generally necessary, it is also acceptable to replace the AN3 bolts provided with longer or shorter AN3 bolts, if required.

A	NEW ISSUE	RF	15.12.10
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 1 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

3.0 D119-646-313/-314 INSTALLATION:

These instructions are for modifying the D119-646-211/-212 Skidtube Installations.

- 3.1 Temporarily remove D3849-043 Training Wearplate from aft end of the skidtube per ICA-D119-646 Section 32.
- 3.2 Position D5376-1 drilling jig tool with the arrow pointing fwd as shown in Figure 3. Use 2x AN3-45A bolts to hold the jig in place. Transfer drill 4x $\varnothing 0.129$ " (#30 drill) holes from D5376-1 drilling jig to skidtube ridge as shown in Figure 3. **Caution:** Drill perpendicular to the skidtube ridge.
- 3.3 Remove drilling jig. Using a 5/16" drill, open up the pilot holes and drill through the skidtube ridge and center web inside of the skidtube. **Caution:** Drill perpendicular to the skidtube ridge.
- 3.4 Countersunk 4x 5/16" holes to $\varnothing 0.348$ " (8.84mm) x 100° as shown in Figure 3 and deburr.
- 3.5 Repeat steps 3.2 to 3.4 for the opposite side of the skidtube.
- 3.6 Vacuum the debris from inside of the skidtube. Touch up affected area using (Alodine 1200 or 1201) per MIL-DTL-5541.
- 3.7 Install 8x D5374-3 Bushings in the new holes. Seal bushings with Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class 'B2' sealant as shown in Section C-C.
- 3.8 Remove and discard all hardware attaching the training wearplates in front of the skidtube ground handling lugs.
- 3.9 If the D119-646-314 Skidtube Protector Kit is required for hoisting operations on the RH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 3.10 If the D119-646-313 Skidtube Protector Kit is required for hoisting operations on the LH side of the aircraft install D5372-1 Plug using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 4 Detail E. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 3.11 If the D119-646-314 Skidtube Protector Kit is required for rappelling operations on the RH side of the aircraft install D5371-2 Hook using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 3.12 If the D119-646-313 Skidtube Protector Kit is required for rappelling operation on the LH side of the aircraft install D5371-1 Hook using 4x AN3-45A bolts, 8x NAS11490D332J washer and 4x MS21042L3 nuts as shown in Section C-C and Figure 5 Detail F. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 3.13 Reinstall the D3849-043 Training Wearplate on the aft end of the skidtube per ICA-D119-646 Section 32, except for hardware under D5369-1/-2 Cable Guard.
- 3.14 Install D5369-2 Cable Guard on the RH side of the aircraft using 6x AN3-50A bolts, 6x D5374-1 Bushings, 6x D3904-1 Washers, 6x MS21042L3 nuts as shown in Figure 2 Section B-B. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 3.15 Install D5369-1 Cable Guard on the LH side of the aircraft using 6x AN3-50A bolts, 6x D5374-1 Bushings, 6x D3904-1 Washers, 6x MS21042L3 nuts as shown in Figure 2 Section B-B. Torque bolts to 15-25 in-lbs (1.7-2.8 N-m).
- 3.16 Update aircraft log book to indicate installation of the D119-646-313/-314 kit and adjust weight and balance record for the aircraft with weight and balance data provided in Section 5.0 of this document.

NOTE: Additional NAS1149D0332J washers may be installed under the nuts to ensure 1.5-4 threads in safety on the bolts. Although not generally necessary, it is also acceptable to replace the AN3 bolts provided with longer or shorter AN3 bolts, if required.

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 2 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By 	
								Lead hand / Supervisor Approval Verification 	
								QC / QA Coordinator Approval 	

Root Cause			FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : 						
Misidentified	☐	Past Due	☐							

4.0 PARTS LIST:

Qty. -313	Qty. -314	PART NUMBER	DESCRIPTION
X		D119-646-313	SKIDTUBE PROTECTOR, LH
	X	D119-646-314	SKIDTUBE PROTECTOR, RH
6	6	D3904-1	WASHER
6	6	D4506-3	WASHER
1		D5369-1	CABLE GUARD, LH
	1	D5369-2	CABLE GUARD, RH
1		D5371-1	HOOK, LH
	1	D5371-2	HOOK, RH
1	1	D5372-1	PLUG
6	6	D5374-1	BUSHING
8	8	D5374-3	BUSHING
1	1	D5376-1	DRILLING JIG
4	4	AN3-45A	BOLT
6	6	AN3-47A	BOLT
6	6	AN3-50A	BOLT
14	14	NAS1149D0332J	WASHER
10	10	MS21042L3	NUT

5.0 WEIGHT AND BALANCE

The following weight and balance changes are applicable:

Installation	Weight	LONGITUDINAL		LATERAL	
		Arm	Moment	Arm	Moment
D119-646-313 SKIDTUBE PROTECTOR, LH	4.3 lb 1.95 kg	108.1 in 4.3 m	465 in-lb 8.4 kg-m	-43.4 in 1.7 m	-187 in-lb -3.3 kg-m
D119-646-314 SKIDTUBE PROTECTOR, RH	4.3 lb 1.95 kg	108.1 in 4.30 m	465 in-lb 8.4 kg-m	43.4 in 1.7 m	187 in-lb 3.3 kg-m

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 3 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval																																																									
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER :			
Misidentified ☐	Past Due ☐																																																																

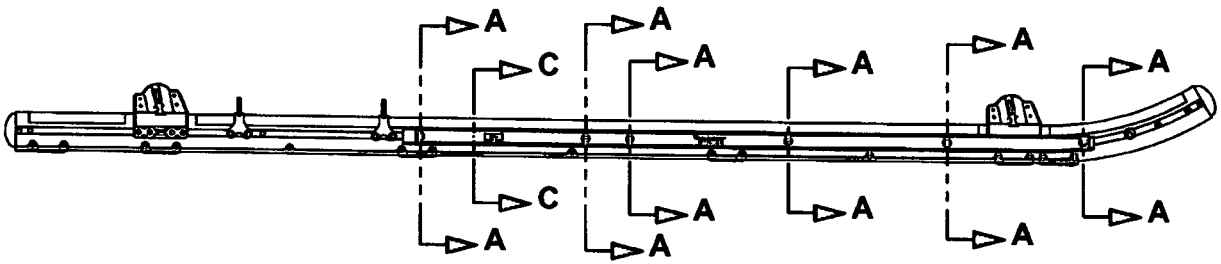


FIGURE 1: D119-646-314 SKIDTUBE PROTECTOR KIT, RH (SHOWN)
(D119-646-313 SKIDTUBE PROTECTOR, LH (OPPOSITE))
(SHOWN INSTALLED ON D119-646-011/-012/-111/-112 SKIDTUBES)

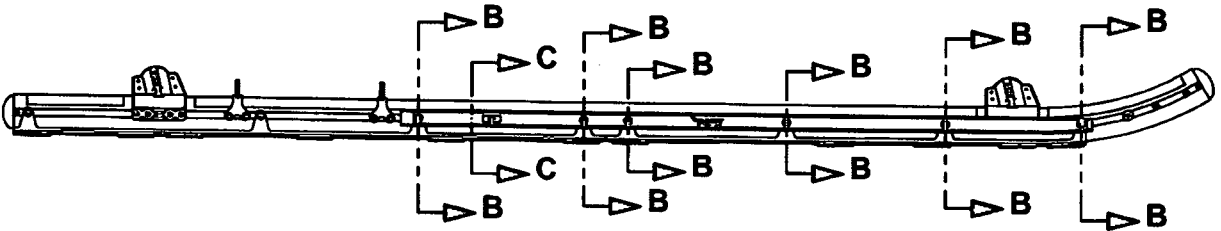


FIGURE 2: D119-646-314 SKIDTUBE PROTECTOR KIT, RH (SHOWN)
(D119-646-313 SKIDTUBE PROTECTOR, LH (OPPOSITE))
(SHOWN INSTALLED ON D119-646-211/-212 SKIDTUBES)

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 4 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

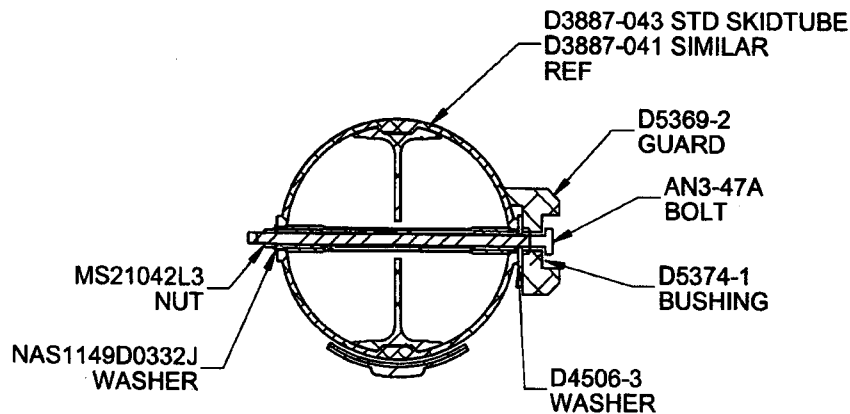

SECTION A-A

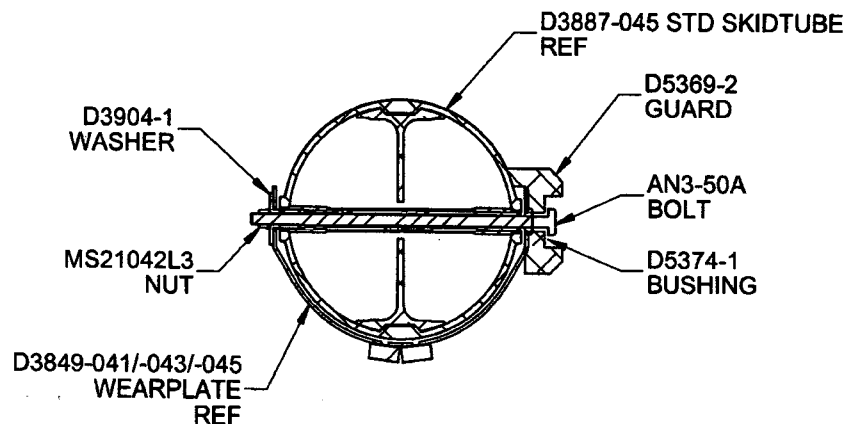

SECTION B-B

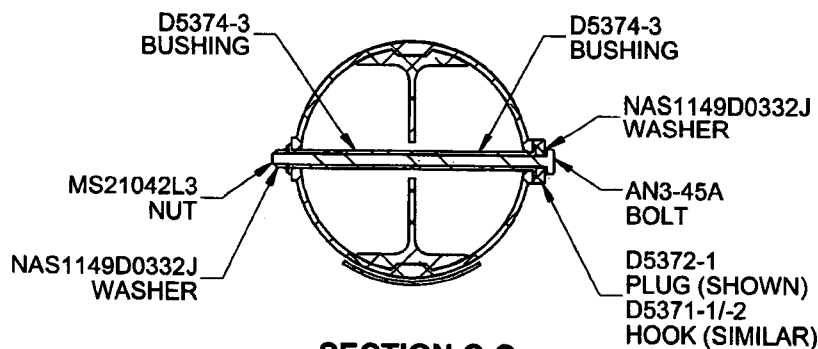

SECTION C-C

(D5369-2 NOT SHOWN FOR CLARITY)

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 5 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation		Disposition			

Root Cause	FAULT CATEGORY		
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : ☐			

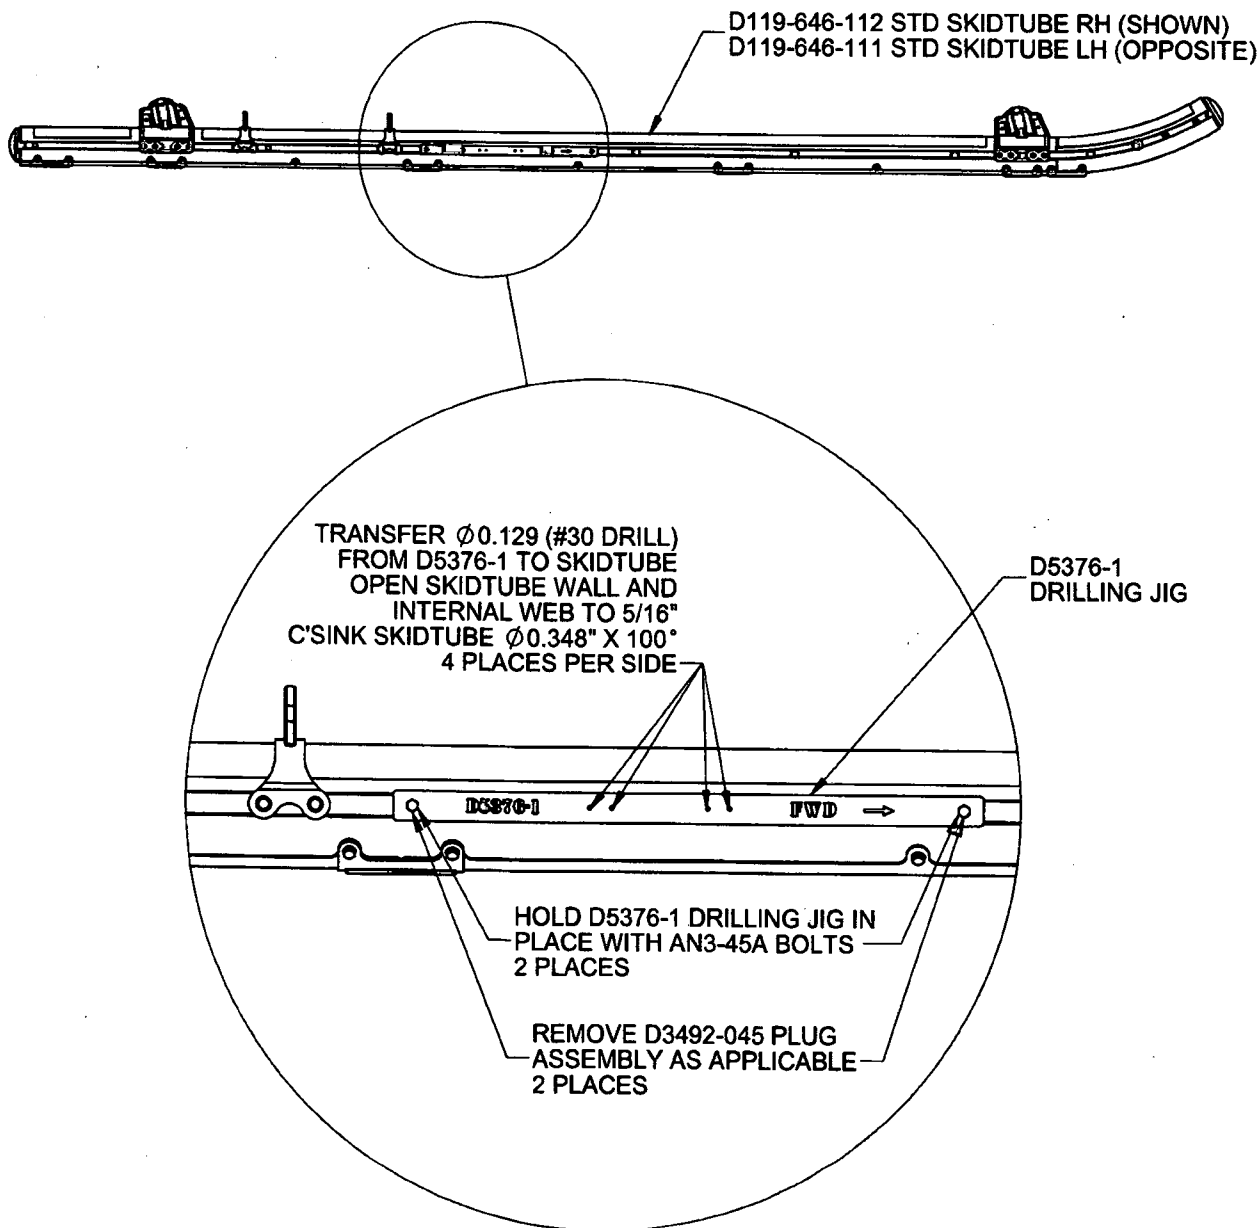


FIGURE 3: USING D5376-1 DRILLING JIG

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 6 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.		SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Misabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER :							
Misidentified ☐	☐ Past Due								

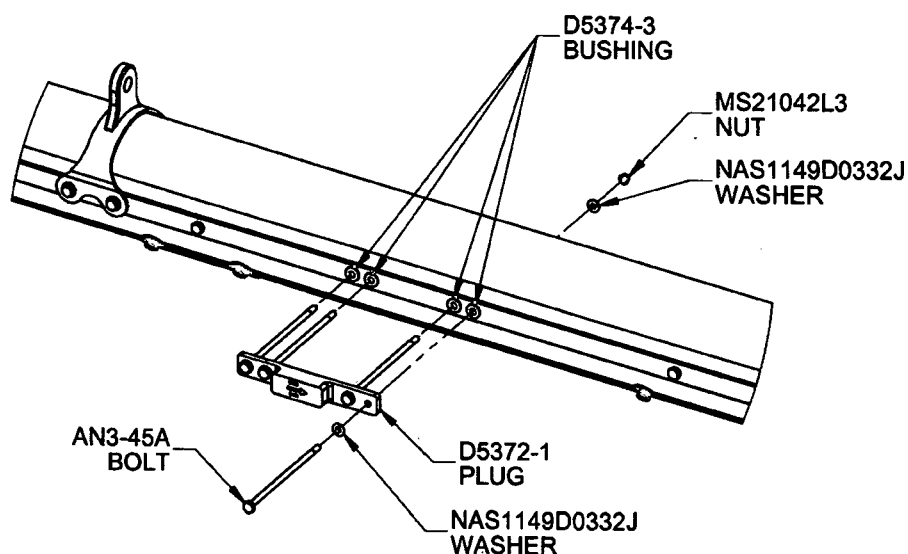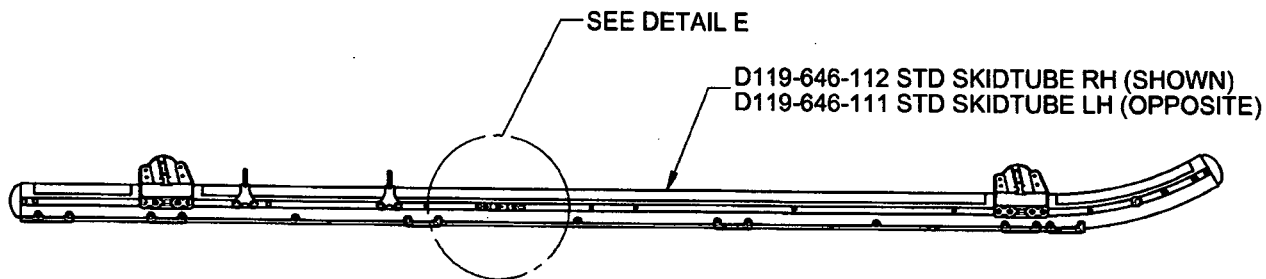

DETAIL E

FIGURE 4: D5372-1 PLUG INSTALLATION

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 7 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

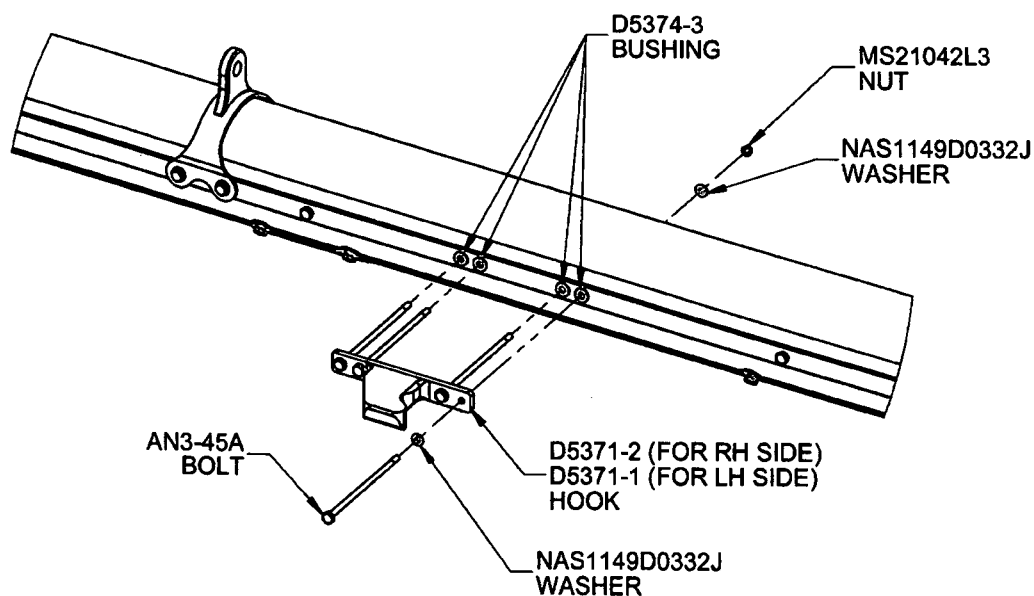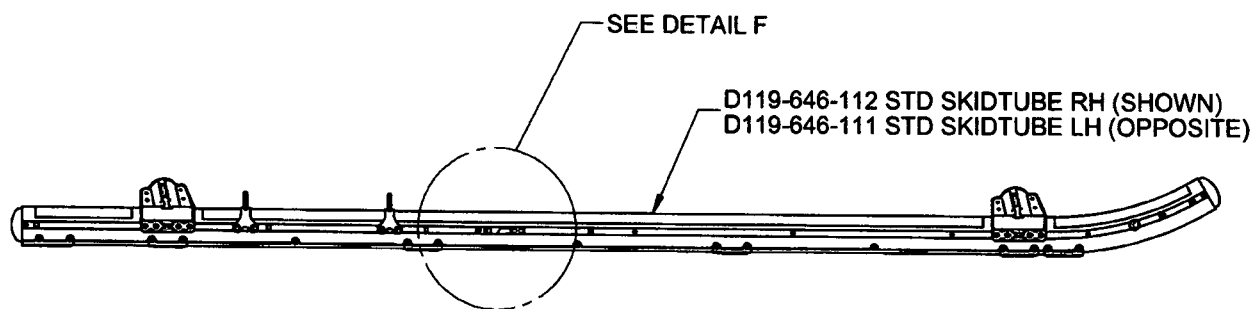

DETAIL F

FIGURE 5: D5371-1/-2 HOOK INSTALLATION

DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	RF		
CHECKED	HS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9734	SHEET 8 OF 8
APPROVED	HS	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	SKIDTUBE PROTECTOR KIT	NTS
DATE	15.12.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause			FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :						
Misidentified	☐	Past Due	☐							